

H10986

NOAA FORM 76-35A

U.S. DEPARTMENT OF COMMERCE
NATIONAL OCEANIC AND ATMOSPHERIC ADMINISTRATION
NATIONAL OCEAN SERVICE

DESCRIPTIVE REPORT

Type of Survey Hydrographic\ Multibeam

Field No. Sheet B

Registry No. H10986

LOCALITY

State Maine

General Locality Casco Bay

Locality 4 Miles East of Cape Elizabeth

2000

CHIEF OF PARTY
Steven A. Lemke

LIBRARY & ARCHIVES

DATE

September 27, 2002

NOAA FORM 77-28 (11-72)	U.S. DEPARTMENT OF COMMERCE NATIONAL OCEANIC AND ATMOSPHERIC ADMINISTRATION	REGISTRY NO. <h1 style="margin: 0;">H10986</h1>
<h2 style="margin: 0;">HYDROGRAPHIC TITLE SHEET</h2>		
INSTRUCTIONS - The Hydrographic Sheet should be accompanied by this form, filled in as completely as possible, when the sheet is forwarded to the Office.		FIELD NO. B
State <u>MAINE</u>		
General locality <u>CASCO BAY</u>		
Locality <u>4 Miles East of Cape Elizabeth</u>		
Scale <u>1:10,000</u> Date of survey <u>21 July - 11 August 2000</u>		
Instructions Dated <u>01 November 1999 as amended</u> Project No. <u>OPR-A318-KR-00</u>		
Vessel <u>R/V OceanExplorer US905425</u>		
Chief of Party <u>STEVEN A. LEMKE</u>		
Surveyed by <u>Steven Lemke, George Ghiorse, Rick Nadeau, Paul Donaldson</u>		
Soundings taken by <u>echo sounder</u> hand lead, pole <u>MULTIBEAM RESON SEABAT 8101</u>		
Graphic record scaled by survey personnel _____		
Graphic record checked by survey personnel _____		
Protracted by _____ Automated plot by <u>HP1055CM (FIELD)</u>		
Verification by <u>ATLANTIC HYDROGRAPHIC BRANCH PERSONNEL</u>		
Soundings in fathoms, <u>feet,</u> meters at MLW, <u>MLLW</u>		
REMARKS: <u>Contract # 50-DGNC-0-90015</u>		
<u>Contractor Name: Science Applications International Corp.</u>		
<u>221 Third Street; Newport, RI 02840</u>		
<u>HAND WRITTEN NOTES IN DESCRIPTIVE REPORT WERE MADE DURING OFFICE PROCESSING.</u>		
<u>AWDLS ✓ & SURF ✓ by MBH on 8/8/02</u>		


NOAA FORM 77-28 SUPERSEDES FORM C&GS-537.

★ U.S. GOVERNMENT PRINTING OFFICE: 1976-665-661/1222 REGION NO. 6

INDEX OF SHEETS

The Progress Sketch on the following page indicates:

1. Survey Outlines
2. Field Survey Letters and Survey Registry Numbers
3. Work Accomplished by Month

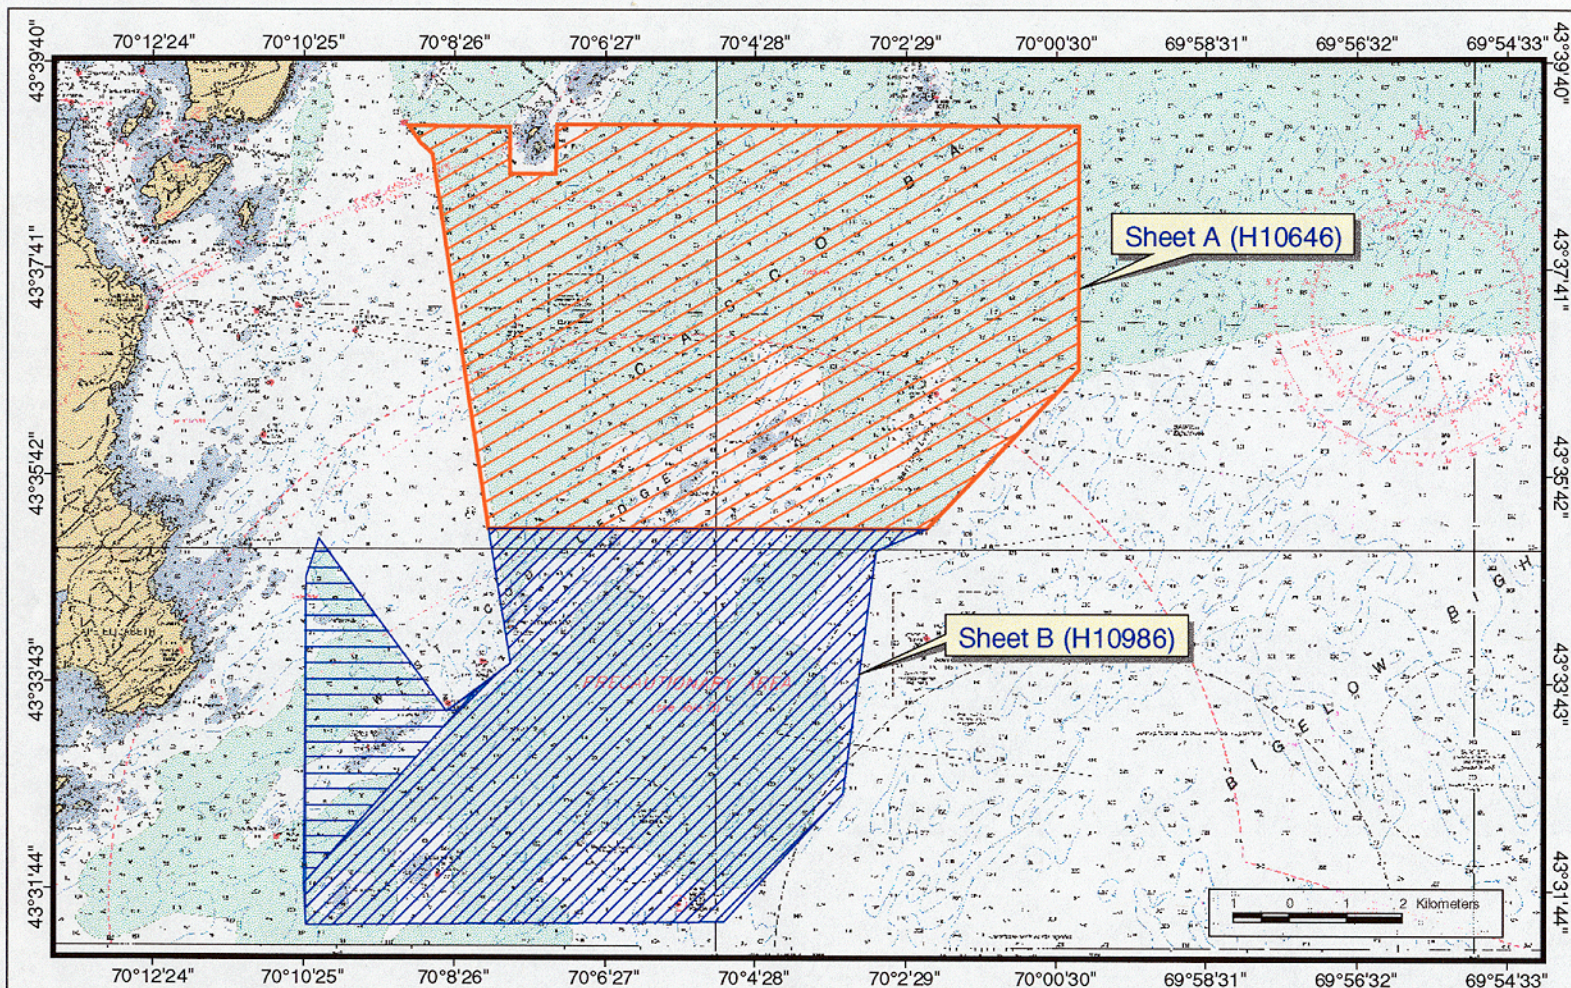

REGISTRY #	STARTED	COMPLETED	SUBMITTED
H10646	7/06/2000	8/11/2000	
H10986	7/21/2000	8/11/2000	

DAYS LOST BY:	JULY	AUGUST
WEATHER	2.0	0.0
BOAT	2.0	0.0
EQUIPMENT	0.0	0.0

PROGRESS SKETCH
 PROJECT OPR-A318-KR
 H10646, H10986 CASCO BAY, ME
 MULTIBEAM SONAR

 R/V OCEANEXPLORER
 SCIENCE APPLICATIONS INTERNATIONAL CORPORATION
 STEVEN A. LEMKE
 HYDROGRAPHER

	STATISTICS			
	SHEET A		SHEET B	
	JULY	AUG	JULY	AUG
LNm	809	96	451	248
SQ NM	21.6	0	14.8	2.4
ITEMS INVESTIGATED	0	0	0	0
SVP CASTS	71	0	26	28
MULTIBEAM COVERAGE	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>

Science Applications International Corporation (SAIC) warrants only that the survey data acquired by SAIC and delivered to NOAA under Contract 50-DGNC-0-90015 reflects the state of the sea floor in existence on the day and at the time the survey was conducted.

Table of Contents

	Page
A. PROJECT	1
B. AREA SURVEYED.....	1
C. SURVEY VESSEL	1
D. AUTOMATED DATA ACQUISITION AND PROCESSING	5
E. SIDESCAN SONAR.....	6
F. SOUNDING EQUIPMENT.....	6
G. CORRECTIONS TO SOUNDINGS	6
H. HYDROGRAPHIC POSITION CONTROL.....	10
I. SHORELINE	11
J. CROSSLINES.....	11
K. JUNCTIONS	11
L. COMPARISON WITH PRIOR SURVEYS	13
M. Item Investigation Reports.....	13
N. COMPARISON WITH THE CHART	13
O. ADEQUACY OF SURVEY	14
P. AIDS TO NAVIGATION	14
Q. STATISTICS.....	14
R. MISCELLANEOUS	15
S. RECOMMENDATIONS.....	15
T. REFERRAL TO REPORTS.....	15

List of Figures

	Page
Progress Sketch	iii
Figure C-1. Configuration of R/V OceanExplorer during Survey Operations, measurements in meters.....	3
Figure C-2. R/V OceanExplorer Draft Determination	4
Figure R-1. Histogram of Selected Soundings by Beam Number – H10986.....	15
Figure R-2. Histogram of Percentage of Selected Soundings by Beam Number - H10986	15

List of Tables

	Page
Table C-1. Survey Vessel Characteristics.....	1
Table C-2. R/V OceanExplorer Antenna and Transducer Locations Relative to the POS/MV IMU Vessel Reference Point, measurements in meters	4
Table G-1. Roll, Pitch, and Heading Bias for the R/V OceanExplorer	10
Table J-1. Junction Analysis All Main Scheme vs. Cross Lines, H10986.....	11
Table K-1. Junction Analysis H10646, vs. H10986 (all comparisons).....	12
Table K-2. Junction Analysis H10646, vs. H10986 (flat bottom).....	12
Table P-1. U.S. Coast Guard Buoys	14
*Table App. D-1. Abstract of Times of Hydrography – H10986.....	17
*Table App. E-1. ODOM Comparison Results for the R/V OceanExplorer	24
*Table App. E-2. Roll Bias Results for R/V OceanExplorer	25
*Table App. E-3. Prorated Draft Results for the R/V OceanExplorer.....	27
*Table App. E-4. Settlement Results for the R/V/ OceanExplorer	27
*Table App. E-5. Accuracy Test Results for the R/V OceanExplorer	28
*Table App. F-1. Average DGPS between the POS/MV and Trimble on the R/V OceanExplorer.....	39
*Table App. F-2. Horizontal Control Point GPS Confidence Check At Newport Shipyard.....	39
*Table App. H-1. SVP Files and Locations.....	41

* DATA FILED WITH ORIGINAL FIELD RECORDS.

**Descriptive Report to Accompany
Hydrographic Survey H10986
Scale 1:10,000, Surveyed 2000
R/V OceanExplorer
Science Applications International Corporation (SAIC)
Steven A. Lemke, Hydrographer**

A. PROJECT**Project Number:** OPR-A318-KR-00**Dates of Instructions:** 1 November 1999

27 June 2000

Original: 50-DGNC-0-90015

Task Order #3: 56-DGNC-0-33003

Dates of Supplemental Instructions: none**Sheet Letters:** B**Registry Number:** H10986**Purpose:** To provide NOAA with modern, accurate hydrographic survey data with which to update the nautical charts of the assigned area.**B. AREA SURVEYED****Description:**

The area surveyed was a section of Casco Bay 4 Miles East of Cape Elizabeth.

Dates of multibeam data acquisition (UTC):

7/21/2000-7/28/2000 203-210

7/31/2000-8/05/2000 213-218

8/11/2000 224

C. SURVEY VESSEL

The R/V OceanExplorer was the platform for multibeam sonar and sound velocity data collection. The main cabin of the vessel was used as the data collection center. All data were shipped to the Data Processing Center in the Newport office for post-processing. The POS/MV IMU was mounted on the vessel centerline just forward and above the RESON 8101 transducer, below the main deck. The multibeam sounder transducer was mounted on the keel. Multibeam data were collected by the 8101. Table C-1 is a list of vessel characteristics for the R/V OceanExplorer.

Table C-1. Survey Vessel Characteristics

Vessel Name	LOA (Ft)	Beam (Ft)	Draft (Ft)	Gross Tonnage	Power (Hp)	Registration Number
R/V OceanExplorer	61'	16'4"	3'3"	56	1100	US905425

The R/V OceanExplorer sensor configuration is depicted in Figure C-1 and the vessel offsets are shown in Table C-2. For these surveys, the R8101 transducer was installed on the hull mount. Figure C-2 shows the draft calculations for the R/V OceanExplorer. All measurements are in meters. The Reference Point for the entire multibeam system is located at the top centerline of the POS/MV IMU. The transducer depth was recorded as 3.07 meters below the boat's main deck. The distance below the boat deck to the water surface was measured and subtracted from the transducer hull depth to determine the draft of the electronic center of the transducer. Measurements were made on each side of the vessel before departure from port and upon return to port in order to prorate the daily draft for fuel and water consumption.

Figure C-1. Configuration of R/V OceanExplorer during Survey Operations, measurements in meters


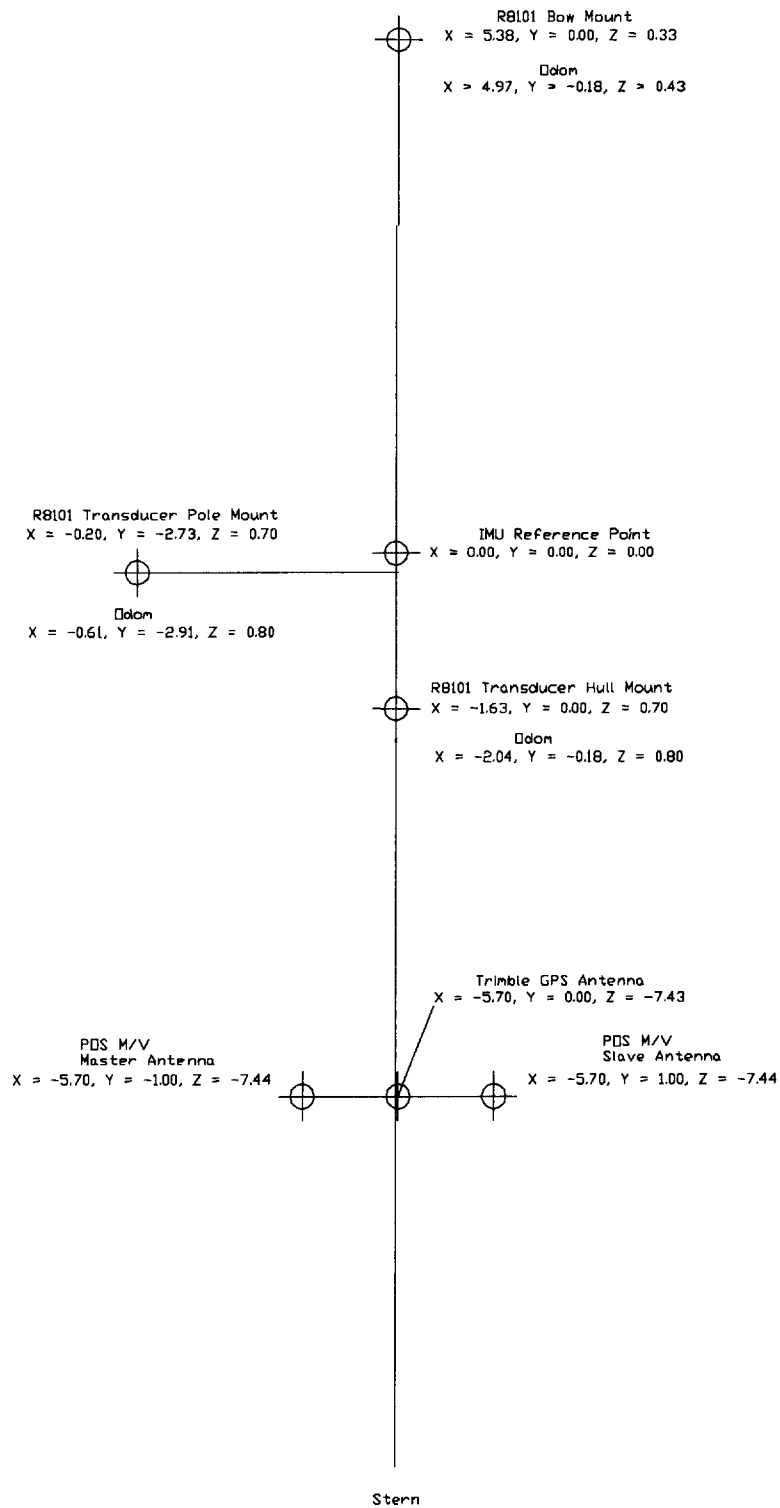


Table C-2. R/V OceanExplorer Antenna and Transducer Locations Relative to the POS/MV IMU Vessel Reference Point, measurements in meters

Sensor	Offset in ISS2000		POS/MV IMU	
Multibeam Reson 8101 Transducer Hull Mount			X	-1.63
			Y	0.00
			Z	0.70
ODOM Singlebeam Transducer	X	-2.04		
	Y	-.018		
	Z	0.80		
Trimble 7400 Antenna	X	-5.70		
	Y	0.00		
	Z	-7.43		
POS/MV GPS Master Antenna			X	-5.70
			Y	-1.00
			Z	-7.44

Figure C-2. R/V OceanExplorer Draft Determination

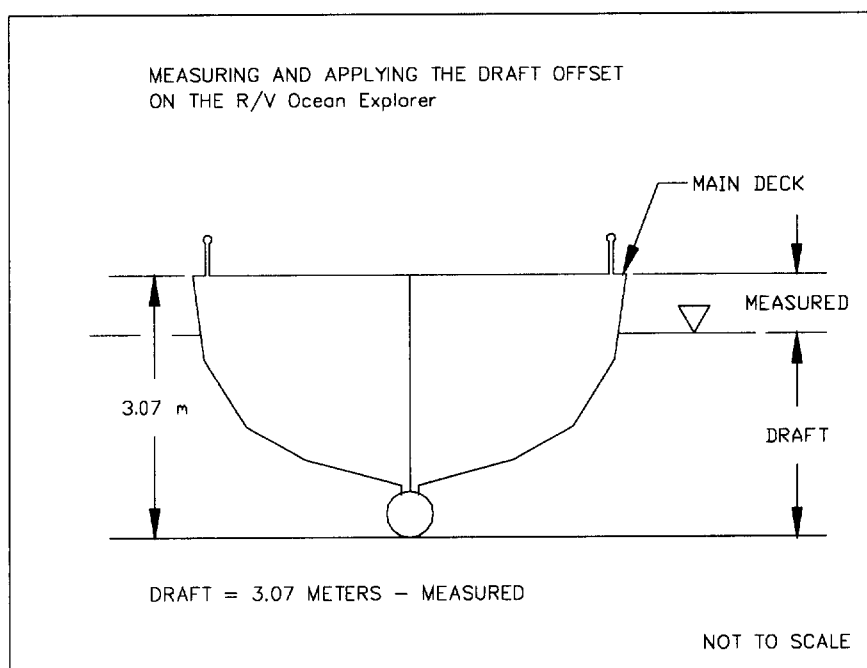

The SAIC Integrated Survey System (*iss2000*) and the RESON 8101 multibeam system utilize different coordinate systems, and care must be taken when inputting correctors to the system. The *iss2000* considers “z” to be positive down, while both the RESON and POS/MV consider “z” positive up. Both the *iss2000* and POS/MV consider “x” positive forward, the RESON considers “x” as positive athwart ships to starboard. The SAIC *iss2000* considers “y” positive athwart ships to starboard, the POS/MV considers “y” positive athwart ships to port and the RESON considers “y” as positive forward.

D. AUTOMATED DATA ACQUISITION AND PROCESSING *SEE ALSO THE EVALUATION REPORT*

Data acquisition was carried out using the SAIC **iss2000** system. Real-time navigation, data time tagging and data logging were controlled by the **iss2000** on a Windows NT 4.0. Survey Planning and data processing were done on UNIX machines.

Navigation was recorded from both the POS/MV system and the Trimble 7400. Data from the POS/MV was used as the primary navigation merged with multibeam data. Positioning confidence checks were performed alongside survey control stations in port during Sea Acceptance Tests. Daily positioning confidence checks for the R/V OceanExplorer were done by comparing data recorded from the POS/MV to data recorded from the Trimble DGPS.

The RESON 8101 range scale was changed between 5 and 200 meters as necessitated by water depth. The data acquisition rate for the R8101 was set at 12 pings per second maximum rate. At an average speed of 8 knots and 12 per pings second, the average alongtrack coverage was 3.1 pings per meter in water depths to 25 meters, 2.4 pings per meter in water depths 25 meters to 40 meters, and 2.0 pings per meter in depths greater than 40 meters. In all cases, ensonification was adequate for detection of 2-meter by 2-meter objects.

Cleaning of the R8101 multibeam data began with an evaluation of the navigation track line. An automated filter was then applied for minimum and maximum depths of 1 and 150 meters. Interactive editing was performed to remove noise, fish, etc. The editing process used the **geoswath** geo-referenced editor which allows for both plan and profile views with each beam in its true geographic position and depth. Predicted tidal correctors were applied in real-time. Observed tides were down loaded from the NOAA/CO-OPS web page. Preliminary and verified data from Portland, ME (841-8150) were applied to the multibeam data using the zoning received June 12, 2000.

Depth data were then binned to 1.5-meter cells. The resulting grids were used for coverage and quality evaluation. When anomalies were seen in the 1.5 meter bins, the edited multibeam files were re-examined and re-edited as needed. When all multibeam files were determined to be satisfactory, the data were binned to a 5-meter cell size, populating the bin with the shoalest sounding in the bin and maintaining its true position and depth with tracking to the **gsf** multibeam data file.

Soundings were selected from the 5-meter binned layer using the **sel_sound** sounding selection program. This routine starts with the shoalest sounding in the survey, flags out soundings that would overlap it on the plot, proceeds to the shoalest remaining sounding and repeats the above process until all soundings in the 5-meter bin layer have been evaluated. The **set_sound** program was run to flag all selected soundings in the **gsf** multibeam data. The selected sounding file, the navigation aids file, and the feature file were combined to produce the smooth sheet in **AutoCAD** and **MicroStation**.

Throughout this descriptive report wherever software is mentioned, it is inferred that the most current version of the software available was used. A complete list of all software versions and dates is provided in Appendix I. *DATA FILED WITH ORIGINAL FIELD RECORDS.*

Multibeam Data Processing

The real time multibeam acquisition system used for the H1098⁶ survey included:

- One Windows NT workstation – Used for system control, survey operations, real-time quality control, POS M/V and Trimble software.
- A custom computer from RESON was used to operate the 8101 system.
- A custom computer from RESON was used to operate the R6042 system.
- Uninterrupted power supplies (UPS) protected the entire system.
- One notebook computer – Used for maintaining daily real-time system logs.

Initial navigation quality control was done on the vessel shortly after the data was collected. Tracklines were created, verified, and corrected to ensure data coverage and to check for navigation errors. Where time allowed, multibeam data were edited onboard the vessel using the **geoswath** editor. At the end of each day, both the raw and processed data were backed up onto 4mm tape and shipped to the data processing lab in Newport, RI.

In the processing lab in Newport, RI, manual editing was completed and reviewed by a data manager or Hydrographer. Any questionable possible obstructions were noted and evaluated by the Hydrographer. A data manager would then correct the data for draft and tides, update the coverage plots, tracklines, sounding bins, selected sounding plots and preliminary data products. The data manager's duties also included routine system backups on all computers and quality control on all data.

Feature analysis was performed correlating multibeam features from different swaths. Multibeam coverage and sounding plots were updated following changes found during the feature analysis. The **iss2000** system used proprietary algorithms to create the binned depths and selected soundings. Final plots were produced exporting data to a dxf format using the **iss2000** software. These data were then imported into **AutoCAD** and **MicroStation** for final map production.

E. SIDESCAN SONAR

Not used by contractor.

F. SOUNDING EQUIPMENT

The following components were used for acquisition of multibeam sounding data using the RESON SeaBat 8101 multibeam system:

- Transducer, Serial Number 099707
- 8101 Processor, Serial Number 13819
- R6042 Controller and Processing Unit, Serial Number 590 P0 794-387

Weekly comparisons of R8101 nadir soundings to ODOM EchoTrak 200 kHz vertical echo sounder are summarized in Appendix E. *DATA FILED WITH ORIGINAL FIELD RECORDS.*

G. CORRECTIONS TO SOUNDINGS

1. Tides and water levels

Preliminary and verified tide data were downloaded from the NOAA CO-OPS web page based on the Portland, ME (841-8150) station. Tide corrector files for each tide zone were created from actual tide data using the **iss2000 tid2hmpps** routine. These corrector files were then applied to the multibeam data using the **apccors** program within the **iss2000 Survey Analysis** software. After verified tides were applied to all multibeam data, grids were created at 1.5 meter cell size. These grids were then analyzed using color change intervals of 0.1, 0.2, 0.5, and 1 meter. This analysis showed shifts due to tide correction errors, unusual currents, storm surges, etc. There were no significant shifts due to tides. *VERIFIED TIDES FROM NOS CO-OPS WEB SITE HAVE BEEN APPLIED TO THE SURVEY DATA.*

2. Speed of Sound

The following systems were used to determine sound velocity profiles for corrections to multibeam sonar soundings.

Brooke Ocean Technology Ltd., Moving Vessel Profiler-30, Serial Number 4404
Calibration Dates: 1 May 2000

Brooke Ocean Technology Ltd., Moving Vessel Profiler-30, Serial Number 4523
Calibration Dates: 11 April 2000

Weekly confidence checks were obtained using consecutive casts with the two SVP sensors. After downloading the SVP casts, both were compared to each other and to the previously applied cast. Computed profiles were copied to the **iss2000** for comparison on the screen. A selected profile was applied to the system, recorded, and sent to the RESON 6042, where refraction was computed for application of speed of sound and ray tracing correctors to the multibeam sounding data. If sounding depths exceeded the cast depth, the RESON 6042 used the bottom sound velocity of the cast to extend the profile to the maximum depth.

Factors considered in determining how often a SVP cast was needed included: shape and proximity of the coastline, sources and proximity of freshwater, seasonal changes, wind, sea state, cloud cover, and changes from the previous profile. Casts were taken at approximately two-hour intervals.

Quality control tools, including real-time displays of color-coded coverage and a multibeam swath editor, were used to monitor how the sound velocity was affecting the multibeam data. Severe effects due to improper sound velocity could easily be seen by viewing multibeam data in an along track direction.

A table including all SVP casts, dates of each cast, the location of the cast, and the maximum depth of each cast is located in Table App. H-1, Appendix H. *DATA FILED WITH ORIGINAL FIELD RECORDS.*

2. Instrument Corrections

No instrument corrections were necessary after the initial installation and calibration was complete.

3. Static draft

Depth of the transducer below the deck was determined from measurements made while the boat was hauled in May 2000. The static draft was observed daily by measuring from the main deck

to the waterline before getting underway and subtracting that measurement from the transducer distance below the deck. If the static draft value changed from the previously noted value, the new value was entered into the **iss2000** system. The static draft was again determined upon return to port and the change in draft was prorated on a daily basis. The measured and prorated draft results are reported in Table App. E-1, Appendix E. *DATA FILED WITH ORIGINAL FIELD RECORDS.*

4. Settlement and Squat

Measurements of settlement and squat were conducted near 41 31 56N 071 19 30W on day 134, May 13, 2000, in 18 meters of water off the end of the Coddington Cove breakwater, Narragansett Bay, RI. The following procedures were used to determine the settlement correctors:

Measurement by Surveyor's Level and Rod, the preferred method when the attitude sensor (IMU) and the transducer are not co-located.

1. Used a surveyor's level and a level rod with target, or a stadia board to measure the elevation of a spot above the attitude sensor (IMU) on the survey boat as the boat was operated at different shaft RPMs.
2. Selected a location to set up a surveyor's level ("level") overlooking adequate water for the survey vessel to run a survey line at various speeds, including full speed. Established communication between "level" and the boat.
3. Selected the "static" point for initial measurements, which was the point at which the vessel was to hold station.
4. Planned the "settlement and squat" survey line through "static". The vessel ran this line at various shaft RPM settings to make settlement and squat measurements. The line ran more nearly toward the "level" than across in front of it. This made it more likely that the observer was able to focus on and read, or direct the reading, of the level rod on the boat. For this reason, a breakwater end was chosen.
5. Marked a spot on the vessel above the attitude sensor (IMU) so that the level rod was always held at the same point on the boat.
6. Stopped the vessel at "static" with the starboard side toward "level".
 - A. Held the rod on mark with face toward "level".
 - B. Adjusted the rod target according to signals from "level".
 - C. On signal from "level", recorded time and rod reading from target.
 - D. Repeated the reading at least three times.
 - E. The NOAA water level gauge at Newport was used to record water levels.
7. On a signal from the surveyor at "level", made way on "settlement and squat" survey lines at predetermined shaft RPM.
 - A. On survey track, held rod on mark with face toward "level".
 - B. Adjusted rod target according to signals from "level".
 - C. On signal from "level", recorded time and rod reading from target. Readings were taken as nearly as possible at "static" to reduce errors from level instrument adjustment and earth curvature.
 - D. Repeated the reading at least three times.
 - E. The NOAA water level gauge at Newport was used to record water levels.
8. Increased speed to the predetermined shaft RPM settings up to and including full speed, and reran "settlement and squat" tests as described in Step 7.
9. Computed the **settlement and squat** correctors:

- A. Computed the water level correctors from the time of the "static" reading to the time of each of the shaft RPM observations. (Water level during shaft RPM pass minus water level "static").
- B. Applied the water level corrector to each of the shaft RPM rod observations.
- C. Subtracted the corrected rod reading at each shaft RPM from the rod reading at "static". These differences are the settlement and squat correctors to be applied when operating at the corresponding shaft RPM.
- D. Constructed a lookup table of shaft **RPM** and **settlement and squat correctors** so that the computer may interpolate a corrector based upon the shaft RPM entered into the system during the survey.
- E. Entered these values in the **iss2000 .cfg** file.

All results are reported in Table App. E-4, Appendix E. *

5. Roll, Pitch and Heading Biases

The following sensor was used for acquisition of Heave, Roll, Pitch and Heading data:

- TSS POS/MV Inertial Navigation System, Serial Number 314

The POS/MV was used for heave, roll, pitch, and heading. The accuracy of the sensor was five percent of one meter or five centimeters for heave, $\pm 0.10^\circ$ dynamic accuracy for roll and pitch, and $\pm 0.05^\circ$ static accuracy for roll and pitch. The dynamic heading accuracy of the unit is better than 0.05° .

Heading, roll, and pitch biases were determined in a series of tests performed in the Narragansett Bay during the Sea Acceptance Test. Prior to conducting any of the tests, an SVP was calculated from the MVP-30 and entered into the RESON system. Initially, the roll, pitch, and heading biases were set to 0° in the RESON system.

For this project SAIC has used a combination of the **geoswath** editor and a spreadsheet to compute the roll bias between the POS/MV IMU and the transducer. This technique was developed and used on the Gulf of Mexico project for roll bias determination over flat bottom. Because the bottom is seldom truly flat, the test is accomplished by running the same line in opposite directions over a smooth bottom. An area is selected for the measurements, and an equal number of port and starboard depth pairs is measured from each direction. The apparent port to starboard slope of the bottom is computed for each pair of measurements. Averaging the equal number of slopes from each direction removes the bottom slope and leaves the roll bias. If a roll bias was in the system at the time of the test, it is added algebraically to the apparent slope to compute the values to be averaged.

On Julian day 132, three separate determinations of roll bias were made and then averaged for a bias value of 0.18.

Roll bias results are shown in Table App. E-2 in Appendix E. *

After the roll bias was calculated and entered into the RESON system, timing latency test and then pitch bias tests were conducted. Timing latency testing was conducted by running the same line in the same direction, at slow speeds then at fast speed, over distinct rocks on the bottom. The **geoswath** editor was used to measure the positions of the rocks from data taken at the two speeds. Differences in positions of the rocks were less than one meter and were both positive and

** DATA FILED WITH ORIGINAL FIELD RECORDS.*

negative in sign as well as across track. This indicated no timing latency, only the scatter associated with DGPS positioning.

Pitch bias testing was conducted by running the same line as for timing latency, but in the opposite direction at the same speed. Positioning of the rocks was similar to the timing results, indicating no pitch bias. Since there was no discernable timing latency or pitch bias as a result of these tests, a bias of 0.0° was kept in the system for the survey.

Following the roll and pitch bias tests, a heading bias test was conducted by running parallel lines in opposing directions so that the outer beams of adjacent swaths ensounded the same rocks used for timing and pitch. Positioning of the rocks was similar to the results of the timing and pitch tests, indicating no heading bias. Therefore, a heading bias of 0.0° was kept in the system for this survey.

*
Table App. E-5 contains the results of the Accuracy test conducted on JD 134. Roll, pitch, and heading biases applied in H10983 are shown in Table G-1. * DATA FILED WITH ORIGINAL FIELD RECORD.

Table G-1. Roll, Pitch, and Heading Bias for the R/V OceanExplorer

Julian Days	203-224
Roll	0.18
Pitch	0.00
Heading	0.00

H. HYDROGRAPHIC POSITION CONTROL *SEE ALSO THE EVALUATION REPORT*

The following equipment was used for positioning on the R/V OceanExplorer:

- TSS POS/MV, Serial Number 314
- Trimble 7400 GPS Receiver, Serial Number 3713A18839
- Trimble Probeacon Differential Beacon Receiver, Serial Number 0220159406
- Leica MX41R Differential Beacon Receiver, Serial Number 3508-102-18550

The primary hydrographic positioning equipment was the POS/MV, which used correctors from the USCG differential station at Brunswick, ME. The **iss2000** monitored HDOP, number of satellites, elevation of satellites, and age of correctors to ensure the resulting hydrographic positioning errors did not exceed five meters at the 95% confidence level. On several occasions age of correctors jumped to between 20 and 25 seconds, with a single jump to 29 seconds. Duration of these jumps was generally less than 3 seconds, with a maximum duration of 12 seconds.

Daily position confidence checks were established using a Trimble DGPS with correctors from the U.S. Coast Guard station at Penobscot, ME. A real-time monitor raised an alarm when the two DGPS positions differed by more than 10 meters horizontally. Positioning confidence checks were well within the allowable inverse distance of less than 5 meters.

All antenna and transducer offsets were measured relative to the POS/MV's IMU. Two separate teams of two people measured and calculated all offsets using a measuring tape. The final offsets from both teams were compared and were found to agree.

I. SHORELINE

Not applicable, shoreline verification was not required.

J. CROSSLINES

There were 35 linear nautical miles of cross lines surveyed and 550 linear nautical miles of main scheme lines surveyed resulting in 6.4 percent coverage by cross lines.

Comparisons of all crossing data in H10986 show that 70.99 % of comparisons are within 30 centimeters and 79.52 % of comparisons are within 40 centimeters. The 21 % of comparisons larger than 40 centimeters are accounted for by the normal small DGPS position scatter in areas of steep slope and rocky bottom. Table J-1 shows the comparisons using all crossings in H10986.

Table J-1. Junction Analysis All Main Scheme vs. Cross Lines, H10986

Depth Difference		All Differences		Positive Differences		Negative Differences		Zero Diff.	
From	To	Count	Cumulative Percent	Count	Cumulative Percent	Count	Cumulative Percent	Count	Percent
0 to 10 cm		256228	32.49	108843	39.53	130565	26.3	16820	
10 to 20 cm		175600	54.76	78556	68.05	97044	45.86		
20 to 30 cm		127926	70.99	42894	83.63	85032	62.99		
30 to 40 cm		67312	79.52	17324	89.92	49988	73.06		
40 to 50 cm		43821	85.08	11133	93.97	32688	79.64		
50 to 60 cm		26917	88.49	5012	95.79	21905	84.06		
60 to 70 cm		17792	90.75	3406	97.02	14386	86.96		
70 to 80 cm		15520	92.72	2428	97.9	13092	89.59		
80 to 90 cm		10195	94.01	1356	98.4	8839	91.37		
90 to 100 cm		8020	95.03	1096	98.79	6924	92.77		
100 to 110 cm		39212	100	3320	100	35892	100		
		788543	100.00%	275368	34.92%	496355	62.95%	16820	2.13%
Volumes (cu. m.): Positive = 465985 Negative = -1655041 Total = -1189056									

Comparisons at 70 crossings in 7 different areas of H10986 comprise approximately 10% of the crossings in the survey, and are listed in the separate* to this report. These comparisons were made over relatively flat bottom, and reflect main scheme soundings taken on several different days. These comparisons show 97.8% are within 40 centimeters and 99.3% are within 50 centimeters. * *DATA FILED WITH ORIGINAL FIELD RECORDS.*

K. JUNCTIONS *SEE ALSO THE EVALUATION REPORT*

The H10986 survey junctions with H10646 (2000). Table K-1 lists the Junction Analysis using all comparisons in the common area. These comparisons show 58.25% were within 50 centimeters. Differences exceeding 50 centimeters are attributed to position differences in

steeply sloping and rocky bottom. Table K-1. lists the Junction Analysis using comparisons in areas of relatively flat bottom. These comparisons show 82.35% were within 40 centimeters and 97.71% were within 50 centimeters.

Table K-1. Junction Analysis H10646, vs. H10986 (all comparisons)

Depth Difference Range		All Difference		Positive Difference		Negative Difference		Zero Difference
From	To	Count	Cumulative Percent	Count	Cumulative Percent	Count	Cumulative Percent	Count
00.0cm	-> 10.0cm	11958	12.17	5762	8.79	5500	17.18	696
10.0cm	-> 20.0cm	11597	23.97	7355	20.01	4242	30.43	
20.0cm	-> 30.0cm	13036	37.24	8974	33.7	4062	43.12	
30.0cm	-> 40.0cm	10416	47.84	7704	45.45	2712	51.59	
40.0cm	-> 50.0cm	10227	58.25	7962	57.6	2265	58.67	
50.0cm	-> 60.0cm	6710	65.08	4831	64.97	1879	64.54	
60.0cm	-> 70.0cm	5809	70.99	4458	71.77	1351	68.76	
70.0cm	-> 80.0cm	5256	76.34	3856	77.65	1400	73.13	
80.0cm	-> 90.0cm	3580	79.98	2556	81.55	1024	76.33	
90.0cm	-> 100.0cm	3482	83.52	2555	85.45	927	79.23	
100.0cm	-> 110.0cm	16190	100	9540	100	6650	100	
sub-totals ->		98261		65553		32012		696
H10646 Sounding Minus H10986 Sounding Junction Analysis, all comparisons								

Table K-2. Junction Analysis H10646, vs. H10986 (flat bottom)

Depth Difference Range		All Difference		Positive Difference		Negative Difference		Zero Difference
From	To	Count	Cumulative Percent	Count	Cumulative Percent	Count	Cumulative Percent	Count
00.0cm	-> 10.0cm	1205	24.88	632	17.00	488	46.88	85
10.0cm	-> 20.0cm	1213	49.93	865	40.27	348	80.31	
20.0cm	-> 30.0cm	773	65.89	594	56.26	179	97.50	
30.0cm	-> 40.0cm	797	82.35	773	77.05	24	99.81	
40.0cm	-> 50.0cm	744	97.71	743	97.04	1	99.90	
50.0cm	-> 60.0cm	81	99.38	80	99.19	1	100.00	
60.0cm	-> 70.0cm	26	99.92	26	99.89	0	100.00	
70.0cm	-> 80.0cm	4	100.00	4	100.00	0	100.00	
80.0cm	-> 90.0cm	0	100.00	0	100.00	0	100.00	
90.0cm	-> 100.0cm	0	100.00	0	100.00	0	100.00	
100.0cm	-> 110.0cm	0	100.00	0	100.00	0	100.00	
sub-totals ->		4843		3717		1041		85
H10646 Sounding Minus H10986 Sounding Junction Analysis, flat bottom								

L. COMPARISON WITH PRIOR SURVEYS *SEE ALSO THE EVALUATION REPORT*

Comparison with prior surveys was not required under this contract, see Section N for comparison to the nautical chart.

M. ITEM INVESTIGATION REPORTS

None.

N. COMPARISON WITH THE CHART *SEE ALSO THE EVALUATION REPORT*

H10986 was compared to Chart 13290, 33rd edition, 04 March 2000 at scale 1:40,000, Chart 13288, 39th edition, 06 November 1999 at scale 1:80,000, and Chart 13260, 37th edition, 07 March 1999 at scale 1:378,838. *CONCUR*

Recommend reconstruction of the common areas of all listed charts using data from this survey. Recommend removal of the charted green tint and associated wire drag clearance symbols in the common areas. *CONCUR*

The following discrepancies were noted during chart comparisons:

In the vicinity of a charted 22 feet near Alden Rock, position 43 32 59.71N, 070 09 37.83W, a depth of 17 feet was found in H10986. This shoaler sounding was found in the direction of a charted 4 feet, near the charted symbol for buoy R N "4". *CONCUR*

A wreck was found in position 43 31 49.40N, 070 10 18.76W on survey H10986 with a least depth of 131 feet near a charted 158 feet. Recommend adding a wreck symbol and appropriate depth to the chart at this position. *CONCUR - CHART 310R 131WK*

*AKM
1/3/02*

In the vicinity of a charted Wreck PA (rep 1993), in 120 feet, position 43 33 17.83N, 070 07 48.11W, no evidence of the wreck or of shoaling was observed in H10986. Recommend removal of charted dangerous wreck symbol and the Wreck PA (rep 1993) annotation. *CONCUR*

DELETE ~~HA~~ PA (REP 1993)

Near charted 52 feet in position 43 34 42N 070 04 37W are depths of 47, 48, and 49 feet. This rock outcrop extends north east to the charted 100 feet in 43 34 50.6N 070 04 20.9W where the depth in H10986 is 74 feet. *CONCUR*

Near charted 33 feet in position 43 34 47.8N 070 06 09.0W is depth of 39 feet in H10986. *CONCUR*

Near charted 34 feet in position 43 35 06.2N 070 05 23.2W is depth of 31 feet in H10986. *CONCUR*

Near charted 47 feet in position 43 34 45.4N 070 07 14.4W is depth of 44 feet in H10986. *CONCUR*

Near charted 40 and 49 feet in position 43 35 00N 070 04 18W is depth of 39 feet in H10986. *CONCUR*

Near charted 51 feet in position 43 35 11.4N 070 04 23.9W is depth of 46 feet in H10986. *CONCUR*

Near charted 57 feet in position 43 32 44.7N 070 010 07.3W is depth of 51 feet in H10986. *CONCUR*

At East Hue and Cry in position 43 31 55.6N 070 08 53.8W the 36 foot curve extends further to the northeast than charted. Recommend revision of depth curves and charted soundings. *CONCUR*

Numerous depth comparison discrepancies occur throughout the survey because of the full coverage by H10986 compared to the partial coverage of previous surveys and the apparent displacement of charted depths because of the steepness of the terrain. *CONCUR*

O. ADEQUACY OF SURVEY *SEE ALSO THE EVALUATION REPORT*

Not used by Contractor.

P. AIDS TO NAVIGATION

U.S. Coast Guard buoys were found on station as listed in Table P-1. These buoys adequately serve their purpose. *CONCUR*

Table P-1. U.S. Coast Guard Buoys

Latitude	Longitude	Buoy Descriptor
43 33 02.63N	070 09 35.81W	R N "4"
43 34 14.23W	070 07 44.54W	R N "4WC"
43 33 30.49W	070 08 29.50W	G "3" Fl G 4s Bell
43 31 36.30W	070 05 29.32W	RW "P" Mo(A) Fl 2.5s Horn RACON (--)
43 31 52.52W	070 08 41.26W	G "1" Fl G 4s

Q. STATISTICS

Survey statistics are as follows:

699 nm	Linear nautical miles of sounding lines (multibeam)
17.2 nm ²	Square nautical miles of multibeam
13	Days of data acquisition
0	Number of detached positions
0	Number of bottom samples
78	Number of sound velocity casts
0	Number of tide stations installed

R. MISCELLANEOUS *SEE ALSO THE EVALUATION REPORT*

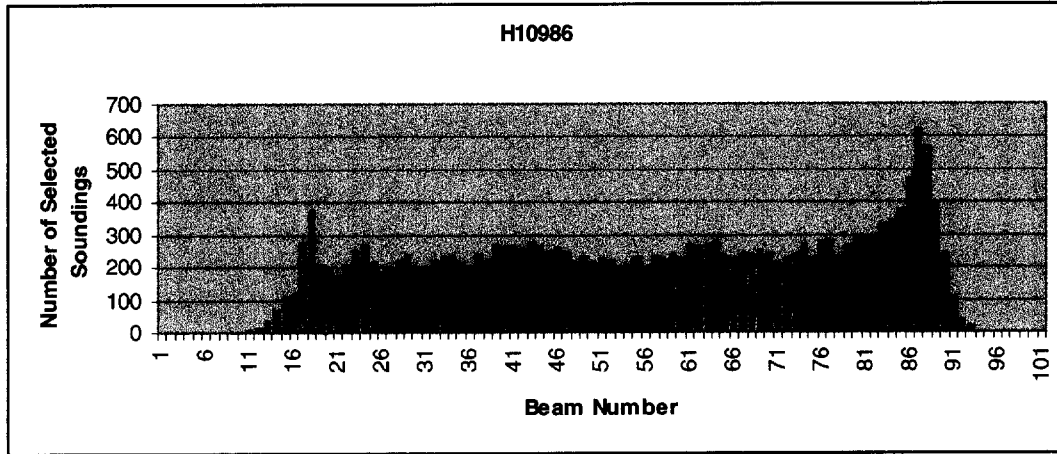


Figure R-1. Histogram of Selected Soundings by Beam Number – H10986

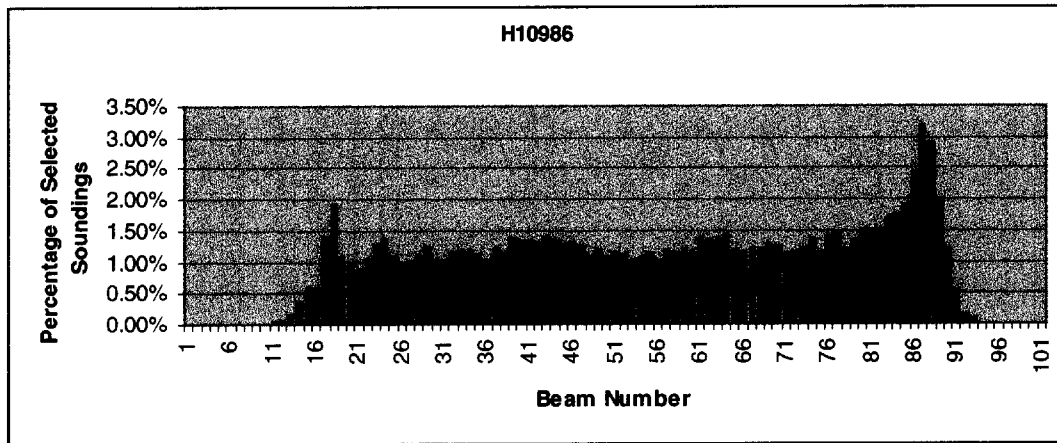


Figure R-2. Histogram of Percentage of Selected Soundings by Beam Number - H10986

S. RECOMMENDATIONS

Recommend the entire common area of charts 13290, 13288, and 13260 be reconstructed with data from this survey. There are no recommendations for further investigation.

T. REFERRAL TO REPORTS

None.

September 22, 2000

LETTER OF APPROVAL

REGISTRY NUMBER H10986

This report and the accompanying smooth sheet are respectfully submitted.

Field operations contributing to the accomplishment of survey H10986 were conducted under my direct supervision with frequent personal checks of progress and adequacy. This report and smooth sheet have been closely reviewed and are considered complete and adequate as per the Statement of Work.

SCIENCE APPLICATIONS INTERNATIONAL CORPORATION



Steven A. Lemke
Hydrographer
September 22, 2000

LETTER TRANSMITTING DATA

DATA AS LISTED BELOW WERE FORWARDED TO YOU
BY (Check)

- ORDINARY MAIL AIR MAIL
- REGISTERED MAIL EXPRESS
- GBL (Give number) _____

DATE FORWARDED 08/05/2002

NUMBER OF PACKAGES 1

TO:

CHIEF, DATA CONTROL GROUP, N/CS3x1
 NOAA / NATIONAL OCEAN SERVICE
 STATION 6815, SSMC3
 1315 EAST-WEST HIGHWAY
 SILVER SPRING, MARYLAND 20910-3282

NOTE: A separate transmittal letter is to be used for each type of data, as tidal data, seismology, geomagnetism, etc. State the number of packages and include an executed copy of the transmittal letter in each package. In addition the original and one copy of the letter should be sent under separate cover. The copy will be returned as a receipt. This form should not be used for correspondence or transmitting accounting documents.

H10986

Maine, Casco Bay, 4 Miles East of Cape Elizabeth

ONE TUBE CONTAINING THE FOLLOWING:

- 1 (AHB) SMOOTH SHEET FOR SURVEY H10986
- 1 (CONTRACTOR) SMOOTH SHEET FOR H10986
- 1 RECORD OF APPLICATION TO CHART FORM (NOAA FORM #75-96)
- 1 H-DRAWING ON MYLAR FOR NOS CHART 13290
- 1 DESCRIPTIVE REPORT FOR H10986

FROM: (Signature)

Richard Blewett

RECEIVED THE ABOVE
(Name, Division, Date)

Return receipted copy to:

NOAA \ NATIONAL OCEAN SERVICE
 ATLANTIC HYDROGRAPHIC BRANCH N/CS33
 439 WEST YORK STREET
 NORFOLK, VA. 23510-1114

**ATLANTIC HYDROGRAPHIC BRANCH
EVALUATION REPORT FOR H10986 (2000)**

This Evaluation Report has been written to supplement and/or clarify the original Descriptive Report. Sections in this report refer to the corresponding sections of the Descriptive Report.

D. AUTOMATED DATA ACQUISITION AND PROCESSING

The following software was used to process data at the Atlantic Hydrographic Branch:

MicroStation J, version 7.1
I/RAS B, version 5.01
NADCON, version 2.10
MapInfo, version 6.5
CARIS HIPS/SIPS 2000

The smooth sheet was plotted using a Hewlett Packard DesignJet 2500CP plotter.

H. HYDROGRAPHIC POSITION CONTROL

Horizontal control used for this survey during data acquisition is based upon the North American Datum of 1983 (NAD 83). Office processing of this survey is based on these values. The smooth sheet has been annotated with ticks showing the computed mean shift between the NAD 83 and the North American Datum of 1927 (NAD 27).

To place this survey on the NAD 27, move the projection lines 0.309 seconds (9.549 meters or 0.95 mm at the scale of the survey) north in latitude, and 1.835 seconds (41.194 meters or 4.12 mm at the scale of the survey) east in longitude.

K. JUNCTIONS

H10646 (2000) to the north

A standard junction was effected between the present survey and survey H10646 (2000).

There are no junctional surveys to the east, south or to the west. Present survey depths are in harmony with the charted hydrography to the east, south and to the west.

L. COMPARISON WITH PRIOR SURVEYS

A comparison with prior surveys was not done during office processing because of the multi-beam full bottom coverage acquired by this survey.

N. COMPARISON WITH CHART 13290 (33rd Edition, MAR 04/00)**Hydrography**

The charted hydrography originates with the prior surveys and requires no further consideration. The hydrographer makes adequate chart comparisons in section N. of the Descriptive Report. Attention is directed to the following:

A charted active dump site in the vicinity of Latitude 43°32'15"N, Longitude 70°06'15"W has charted soundings from surveys conducted between 1946 and 1953. The dump site was fully covered with 200% multibeam. It is recommended that the charted sounding inside the active dump site be superseded by soundings from the present survey and the notation be updated to reflect the date of this survey.

The present survey is adequate to supersede the charted hydrography within the common area.

O. ADEQUACY OF SURVEY

This is an adequate hydrographic/multibeam survey. No additional field work is recommended.

R. MISCELLANEOUS

Chart compilation was done by Atlantic Hydrographic Branch personnel, in Norfolk, Virginia. Compilation data will be forwarded to Marine Chart Division, Silver Spring, Maryland. The following NOS Charts were used for compilation of the present survey:

13290 (33rd Edition, Mar. 04/00)

Robert Snow

Robert Snow

Cartographic Technician
Verification of Field Data
Evaluation and Analysis

APPROVAL SHEET
H10986

Initial Approvals:

The completed survey has been inspected with regard to survey coverage, delineation of depth curves, development of critical depths, cartographic symbolization, and verification or disproval of charted data. The digital data have been completed and all revisions and additions made to the smooth sheet during survey processing have been entered in the digital data for this survey. The survey records and digital data comply with NOS requirements except where noted in the Evaluation Report.

Richard W. Blevins Date: July 2, 2002
Richard W. Blevins
Cartographer
Atlantic Hydrographic Branch

I have reviewed the smooth sheet, accompanying data, and reports. This survey and accompanying digital data meet or exceed NOS requirements and standards for products in support of nautical charting except where noted in the Evaluation Report.

Emily B. Christman Date: July 5, 2002
Emily B. Christman
Commander, NOAA
Chief, Atlantic Hydrographic Branch

Final Approval:

Approved: Samuel P. De Bow, Jr. Date: September 27, 2002
Samuel P. De Bow, Jr.
Captain, NOAA
Chief, Hydrographic Surveys Division

MARINE CHART BRANCH
RECORD OF APPLICATION TO CHARTS

FILE WITH DESCRIPTIVE REPORT OF SURVEY NO. H/10986

INSTRUCTIONS

A basic hydrographic or topographic survey supersedes all information of like nature on the uncorrected chart.

1. Letter all information.
2. In "Remarks" column cross out words that do not apply.
3. Give reasons for deviations, if any, from recommendations made under "Comparison with Charts" in the Review.

CHART	DATE	CARTOGRAPHER	REMARKS
13290	07/18/02	<i>Richard Blum</i>	Full Part Before After Marine Center Approval Signed Via
			Drawing No.
			Full Part Before After Marine Center Approval Signed Via
			Drawing No.
			Full Part Before After Marine Center Approval Signed Via
			Drawing No.
			Full Part Before After Marine Center Approval Signed Via
			Drawing No.
			Full Part Before After Marine Center Approval Signed Via
			Drawing No.
			Full Part Before After Marine Center Approval Signed Via
			Drawing No.
			Full Part Before After Marine Center Approval Signed Via
			Drawing No.
			Full Part Before After Marine Center Approval Signed Via
			Drawing No.
			Full Part Before After Marine Center Approval Signed Via
			Drawing No.
			Full Part Before After Marine Center Approval Signed Via
			Drawing No.
			Full Part Before After Marine Center Approval Signed Via
			Drawing No.
			Full Part Before After Marine Center Approval Signed Via
			Drawing No.
			Full Part Before After Marine Center Approval Signed Via
			Drawing No.
			Full Part Before After Marine Center Approval Signed Via
			Drawing No.
			Full Part Before After Marine Center Approval Signed Via
			Drawing No.
			Full Part Before After Marine Center Approval Signed Via
			Drawing No.
			Full Part Before After Marine Center Approval Signed Via
			Drawing No.
			Full Part Before After Marine Center Approval Signed Via
			Drawing No.
			Full Part Before After Marine Center Approval Signed Via
			Drawing No.